MARION COUNTY SURVEYOR'S OFFICE

SECTION CORNER RECORD

DEBRA S. JENKINS MARION COUNTY SURVEYOR

SEC. 9 TWN. 14_{N} RNG. 2_{E}

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

Date: 2-3-10

Party Chief: Wilcoxen


Crew: Finney


Type of Marker: Cut 'x' in concrete


Method of Establishment: County: 2-3-2010

IN S.P.C. E Zone, NAD 83 (1986)

Name: 14020901 N: 491 743.925 0(m) E: 43 390.244 0(m)

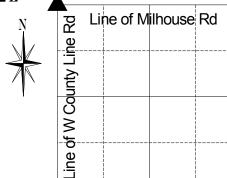

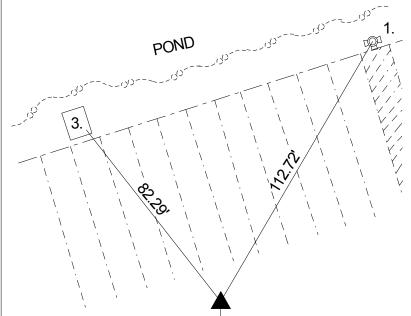

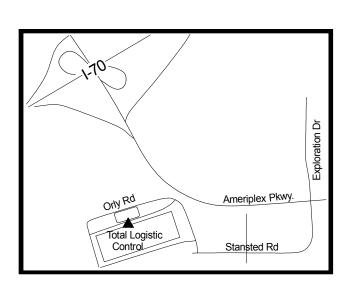

Dock 52 Dock 51

Original post set by Wm. B. Laughlin in 1820 with witnesses: 10" Beech N 80 E 23 links, 8" Buckeye S 63 W 25 links, as per the Marion County Atlas page 1. No mention is made of this corner in the Decatur Twp. Legal Book. Several surveys by Holloway and Associates for the Indianapolis Airport Authority; for example, file no. 228-93, dated 9/10/1993, recorded as Inst. No. 93-147283, refer to an iron pin found at this corner. An INDOT Route Survey by American Consulting Engineers, project no. DEM-070-3(196)68, signed 2/08/02, recorded as Inst. Nos. 2002-5452 & 2002-46187 in Hendricks County, reference a rebar that generally agrees with the Holloway surveys. An INDOT Route Survey by Bernardin-Lochmueller & Associates, project no. 101-0042-OSV/SVOC, signed 8/8/02, recorded as Inst. No. 020167806, references the prior A.C.E. survey. A survey by The Schneider Corporation, project no. 6087.003, dated 10/9/06, found a 5/8" rebar 12" below the surface per the Holloway survey and provided geometry to several additional corners. 2-3-2010 Wilcoxen cut an "X" in the concrete parking lot to mark the corner.

REF.	DISTANCE	DESCRIPTION
1.	112.72'	Top nut of fire hydrant
2.	127.37'	Face of 8" steel post by steps
3.	82.29'	Cut 'x' SE concrete corner of pump station